

# 1.0" Single Digit Numeric Displays

## Technical Data Sheet

## Model No.: KW1-1001XWB



## Features:

- ◊ 1.0"(inch) digit height.
- Excellent segment uniformity.
- ◊ Sold state reliability.
- ◊ Industrial standard size.
- ◊ Low power consumption.
- ♦ The product itself will remain within RoHS compliant Version.

## Descriptions:

- The KW1-1001XXX series is a lager 25.4mm(1.0") high seven segments display designed for viewing distances up to 7 meters.
- ◇ These displays provide excellent reliability in bright ambient light.
- $\diamond$  These devices are made with white segments and black surface.

## Applications:


- Audio equipment.
- ◊ Instrument panels.
- ◊ Digital read out display.

## Device Selection Guide:

Model No.	Chip Material	Source Color	Description
KW1-1001AWB		white	Common Anode
KW1-1001CWB	InGaN	white	Common Cathode



## Package Dimension:

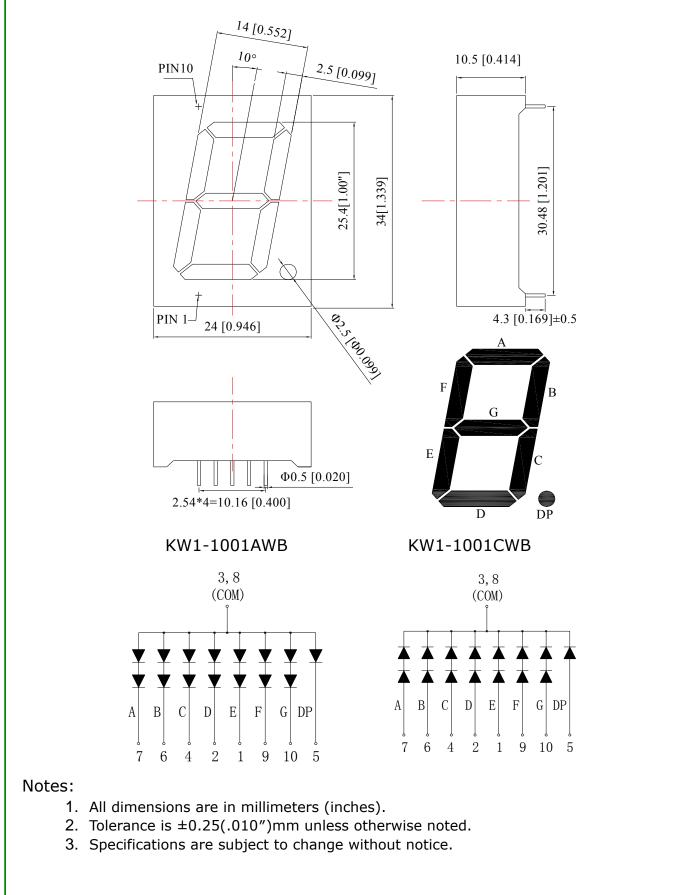



## Absolute Maximum Ratings at $Ta=25^{\circ}C$

Parameters	Symbol	Max.	Unit
Power Dissipation Per Segment	PD	200	mW
Peak Forward Current Per Segment (1/10 Duty Cycle, 0.1ms Pulse Width)	IFP	100	mA
Forward Current Per Segment	IF	25	mA
Dating Linear From 50°C		0.4	<b>mA/</b> °C
Reverse Voltage	VR	5	V
Operating Temperature Range	Topr	-40℃ to +80℃	
Storage Temperature Range	Tstg	-40℃ to +85℃	
Soldering Temperature	Tsld	260 $\degree$ for 5 Seconds	


## Electrical Optical Characteristics at Ta=25 $^\circ\!\!\!\mathrm{C}$


Parameters	Symbol	Min.	Тур.	Max.	Unit	Test Condition
Luminous Intensity (Note 1) *	IV	45	90.0		mcd	IF=20mA
Luminous Intensity Matching Ratio (Segment To Segment)	I <sub>v-m</sub>			2:1		IF=10mA
Chromaticity Coordinates (Note 2)	Х		0.31			IF=20mA
	Y		0.32			
Forward Voltage	VF		6.4	8.0	V	IF=20mA
Reverse Current	IR			50	μA	V <sub>R</sub> =5V

#### Notes:

- 1. Luminous Intensity Measurement allowance is  $\pm$  10%.
- 2. It use many parameters that correspond to the CIE 1931 2°. X, Y, and Z are CIE 1931 2° values of Red, Green and Blue content of the measurement.





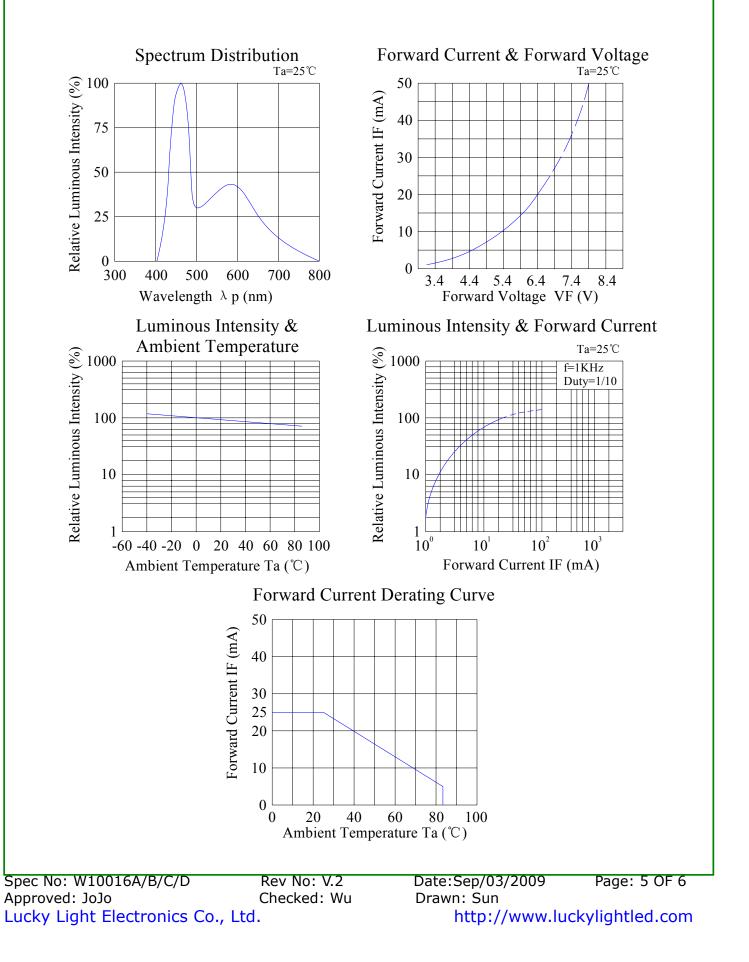



## Please read the following notes before using the datasheets:

### 1. Over-current-proof

Customer must apply resistors for protection, otherwise slight voltage shift will cause big current change (Burn out will happen).

#### 2. Storage

2.1 If the package contains a moisture proof bag inside, please don't open the package before using.

2.2 Before opening the package, the LEDs should be kept at  $30^\circ\!\!\mathbb{C}$  or less and 80%RH or less.

2.3 The LEDs should be used within a year.

2.4 After opening the package, the LEDs should be kept at 30  $^\circ\!{\rm C}$  or less and 60%RH or less.

#### 3. Soldering Iron

Each terminal is to go to the tip of soldering iron temperature less than  $260^{\circ}$  for 5 seconds within once in less than the soldering iron capacity 25W. Leave two seconds and more intervals, and do soldering of each terminal. Be careful because the damage of the product is often started at the time of the hand solder.

#### 4. Soldering

When soldering, for Lamp without stopper type and must be leave a minimum of 3mm clearance from the base of the lens to the soldering point.

To avoided the Epoxy climb up on lead frame and was impact to non-soldering problem, dipping the lens into the solder must be avoided.

Do not apply any external stress to the lead frame during soldering while the LED is at high temperature.

Recommended soldering conditions:

Soldering Iron		Wave Soldering		
Temperature Soldering Time	300℃ Max. 3 sec. Max. (one time only)	Pre-heat Pre-heat Time Solder Wave Soldering Time	100℃ Max. 60 sec. Max. 260℃ Max. 5 sec. Max.	

Note: Excessive soldering temperature and / or time might result in deformation of the LED lens or catastrophic failure of the LED.

#### 5. Repairing

Repair should not be done after the LEDs have been soldered. When repairing is unavoidable, a double-head soldering iron should be used. It should be confirmed beforehand whether the characteristics of the LEDs will or will not be damaged by repairing.

#### 6. Caution in ESD

Static Electricity and surge damages the LED. It is recommended to use a wrist band or anti-electrostatic glove when handling the LED. All devices equipment and machinery must be properly grounded.