

18mm Round Light Bar Display

Technical Data Sheet

Part No.: KWL-C181GW

Spec No.: R18ARev No.: V.2Approved: JoJoChecked: WuLucky Light Electronics Co., Ltd.

Date: Nov/03/2002 Page: 1 OF 6 Drawn: Sun http://www.luckylightled.com



Features:

- ◊ Industrial standard size.
- ♦ Low power consumption.
- ◊ Categorized for luminous intensity.
- ♦ The product itself will remain within RoHS compliant Version.

Descriptions:

 The KWL-C181 series is 18mm light bar display, designed for viewing distances up to 7 meters.

Applications:


- ◊ Audio equipment.
- ◊ Instrument panels.
- ◊ Digital read out display.


Device Selection Guide:


| | Part No. | Chip Material | Face Color | Source Color |
|------|------------|---------------|----------------|--------------|
| | KWL-C181GW | GaP | White Diffused | Yellow Green |
| | KWL-CI8IGW | GaP | white Diffused | Yellow Green |
| | | | | |
| | | | | |
| | | | | |
| יר N | 0 · R18A F | Rev No · V 2 | Date: Nov/03/2 | 2002 Page: 2 |




Package Dimension:

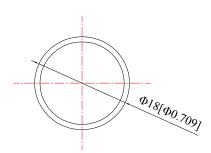

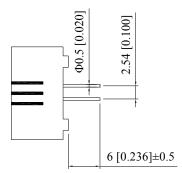

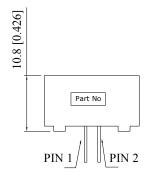





Notes:

- 1.All dimensions are in millimeters (inches).
- 2.Tolerance is \pm 0.25 mm (.010") unless otherwise noted.
- 3. Specifications are subject to change without notice.

Spec No.: R18A Rev No.: V.2 Approved: JoJo Checked: Wu Lucky Light Electronics Co., Ltd.

Date: Nov/03/2002 Drawn: Sun http://www.luckylightled.com

Page: 3 OF 6



Absolute Maximum Ratings at Ta=25℃

| Parameter | Symbol | Max. | Unit |
|--|--------|----------------------------------|-----------------|
| Power Dissipation | PD | 168 | mW |
| Peak Forward Current (1/10 Duty Cycle, 0.1ms Pulse Width) | IFP | 100 | mA |
| Forward Current | IF | 30 | mA |
| Derating Linear From 50°C | | 0.4 | mA/ °C |
| Reverse Voltage | VR | 5 | V |
| Operating Temperature Range | Topr | -40℃ t | :o +80 ℃ |
| Storage Temperature Range | Tstg | -40℃ to +85℃ | |
| Soldering Temperature | Tsld | 260 [°] C for 5 Seconds | |


Electrical Optical Characteristics at Ta=25°C


| Parameters | Symbol | Min. | Тур. | Max. | Unit | Test Condition |
|--------------------------|--------------------|------|------|------|------|------------------|
| Luminous Intensity | Iv | 2.5 | 5.0 | | mcd | IF=30mA (Note 1) |
| Peak Emission Wavelength | λр | | 568 | | nm | IF=30mA |
| Dominant Wavelength | λd | | 572 | | nm | IF=30mA (Note 2) |
| Spectral Line Half-Width | $	riangle \lambda$ | | 20 | | nm | IF=30mA |
| Forward Voltage | VF | | 4.0 | 5.6 | V | IF=30mA |
| Reverse Current | IR | | | 50 | μA | VR=5V |

Notes:

- 1.Luminous intensity is measured with a light sensor and filter combination that approximates the CIE eye-response curve.
- 2.The dominant wavelength (λ d) is derived from the CIE chromaticity diagram and represents the single wavelength which defines the color of the device.





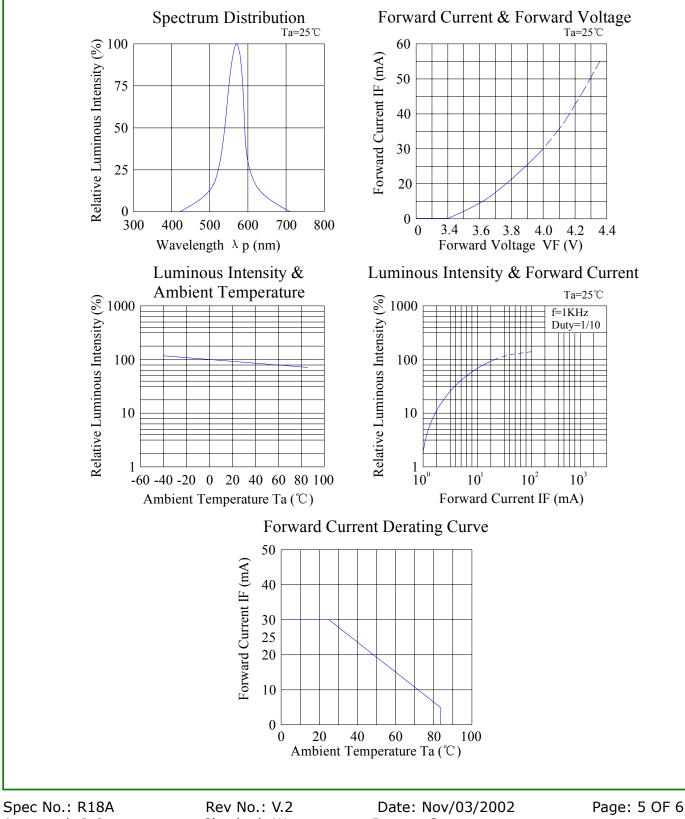

Approved: JoJo Checked: Wu Lucky Light Electronics Co., Ltd.

Drawn: Sun

http://www.luckylightled.com



Please read the following notes before using the datasheets:

1. Over-current-proof

Customer must apply resistors for protection, otherwise slight voltage shift will cause big current change (Burn out will happen).

2. Storage

2.1 If the package contains a moisture proof bag inside, please don't open the package before using.

2.2 Before opening the package, the LEDs should be kept at $30^\circ\!\!\mathbb{C}$ or less and 80%RH or less.

2.3 The LEDs should be used within a year.

2.4 After opening the package, the LEDs should be kept at 30 $^\circ\!\!{\rm C}$ or less and 60%RH or less.

3. Soldering Iron

Each terminal is to go to the tip of soldering iron temperature less than 260° for 5 seconds within once in less than the soldering iron capacity 25W. Leave two seconds and more intervals, and do soldering of each terminal. Be careful because the damage of the product is often started at the time of the hand solder.

4. Soldering

When soldering, for Lamp without stopper type and must be leave a minimum of 3mm clearance from the base of the lens to the soldering point.

To avoided the Epoxy climb up on lead frame and was impact to non-soldering problem, dipping the lens into the solder must be avoided.

Do not apply any external stress to the lead frame during soldering while the LED is at high temperature.

Recommended soldering conditions:

| Solder | Soldering Iron | | Wave Soldering | | |
|-------------------------------|--|--|---|--|--|
| Temperature Soldering Time | 300°C Max. 3 sec. Max. (one time only) | Pre-heat Pre-heat Time Solder Wave Soldering Time | 100℃ Max. 60 sec. Max. 260℃ Max. 5 sec. Max. | | |

Note: Excessive soldering temperature and / or time might result in deformation of the LED lens or catastrophic failure of the LED.

5. Repairing

Repair should not be done after the LEDs have been soldered. When repairing is unavoidable, a double-head soldering iron should be used . It should be confirmed beforehand whether the characteristics of the LEDs will or will not be damaged by repairing.